



## Rescue Stick Safety Advisory

### For Rescue Sticks Shipped Prior To February 22<sup>nd</sup>, 2007

Mustang Survival has become aware of a fault with a very small number of Halkey-Roberts oral inflation tubes that are used on the **RESCUE STICK ONLY**. The affected units deflate immediately following inflation due to the valve in the oral inflation tube not remaining closed. This was caused by vacuum deflation of the unit under certain conditions. By catching the fault in the early stages we are able to limit the advisory to five (5) production lots. **This oral inflation tube is not used in any Mustang Survival Inflatable Personal Flotation Devices (life jackets).**


The affected Rescue Stick models are **MRD100 (US)** and **MRD101 (Canada)** with lot numbers **201071, 311061, 312061, 401071, 411061** that **do not have an inspection stamp next to the UPC barcode** on the product packaging insert and shipped prior to February 22, 2007.



**Inspection Required**



**No Action Required**

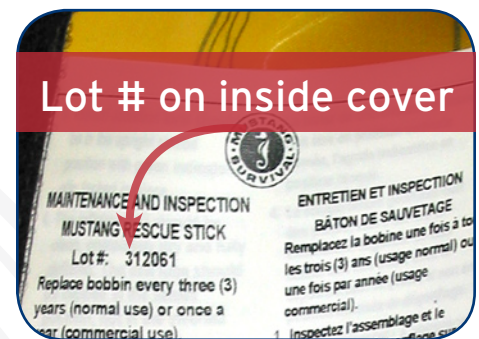

**Where to find the Lot #**

Mustang Survival takes this issue very seriously. As a precautionary measure, we are asking dealers who have any of the affected Rescue Sticks on hand to contact our Customer Service department at 1.800.526.0532 to arrange a no-charge replacement shipment of Rescue Sticks once a return authorization number has been issued.

### Consumers

Consumers who have purchased a Rescue Stick, **which does not have an inspection stamp and is from the identified lots**, can conduct a simple test to see if their unit is affected by this fault:

- Unpack the Rescue Stick
- Inflate it fully using the oral inflation tube
- Leave it overnight
- Check to see that it is still fully inflated

If the unit has remained inflated, it is not affected and can be deflated and repacked.

If the unit deflates or if you do not wish to perform your own test you can contact our Customer Service department at 1.800.526.0532 to obtain authorization to return the product and receive a no-charge replacement.

To view the Halkey-Roberts Technical Advisory which describes the fault in the oral inflation tube, please visit their website at [www.halkey-roberts.com](http://www.halkey-roberts.com).

If you require any further information on this safety alert, please contact Mustang Survival Customer Service at 1.800.526.0532.

**Customer Service 1.800.526.0532**  
**[mustangsurvival.com](http://mustangsurvival.com)**

**WE SAVE LIVES FOR A LIVING**



RS Advisory\_11May2007